

检测报告

编号: J1802059R01C

报告日期: 2018/03/23

页码: 1 of 12

委托单位: 上海日成电子有限公司

地址: 上海奉贤区拓林镇新林路950号

以下检测的样品由委托人提供及确认:

样品信息

样品名称: 金属电缆防水接头

样品型号: BSM-M25×1.5NEMC(11-16)/V0、BSM-M25×1.5NEMC(14-19)/V0、

BSM-M32×1.5NEMC(17-21)/V0、BSM-M32×1.5NEMC(14-19)/V0、

BSM-M25×1.5NEMC(14-19)/V0、BSM-M32×1.5NEMC(17-21)/V0、BSM-M32×1.5NEMC(14-19)/V0、

检测标准: GB19280-2003/IEC60332-1-2:2004

生产厂商:

委托日期: 2018年2月6日

检测地点:

检测时间: 1. 2018年3月23日

检测环境:

1. The test is conducted in accordance with the test method specified in the standard and the test results are valid only when the test is conducted in accordance with the test method specified in the standard.

2. The test results are valid only when the test is conducted in accordance with the test method specified in the standard.

3. The test results are valid only when the test is conducted in accordance with the test method specified in the standard.

检测结论: 经检测, 样品符合GB19280-2003/IEC60332-1-2:2004标准要求。

检测单位: 苏州世恩检测技术有限公司



声明: 本报告无往他处“检测专用章”无效; 检测报告仅对送检检测样品的测试结果负责; 任何篡改、修改或部分篡改本报告均属无效; 本报告书除了数据和结果外的其他基础信息均由委托人确认。

苏州世恩检测技术有限公司

地址: 昆山市周市镇华盛东路5号2-3号房, 215214, CHN

电话 (Tel): +86(0)512-57565899

传真 (Fax): +86(0)51250352609

E-mail: shien@shien.com.cn

检 测 报 告

编号: U1802050901C

报告日期: 2018/03/22

页码: 2/3

检测设备:

序号	设备名称	设备编号	校准有效期
1	高频振动试验机	VB-XK00-01	2017/02/22~2018/02/21
2	三综合试验箱	HT-HK00-04	2017/03/24~2018/03/23
3	防水试验装置	HT-XK00-03	2017/08/05~2018/08/04

实验室环境:

环境温度	(23±5) °C	相对湿度	(50±25)% RH
------	-----------	------	-------------

检测标准与条件:

1.三综合试验

温度条件

温度范围: (-40~105) °C;

单个循环温湿度变化如下:

步骤	时间 (min)	温度 (°C)
1	0	20
2	60	-40
3	150	-40

检 测 报 告

编号: J1802059R01C

报告日期: 2018/03/23

页码: 5/17

400	0.2
1000	0.2
RMS=27.1 m/s ²	

试验时间: 8 h

无水进入。

备注: 2018/03/21 客户更换夹具复测IPX8。

检测结果:**1.三综合试验**

测试后, 目视检查, 6 pcs 样品外观均无损坏, 无松动, 无滑落。

2. IPX8

第一次测试后, 目视检查, 6 pcs 样品外观均无异常, 拆开检查, 内部均无进水现象;

复测后, 目视检查, 6 pcs 样品外观均无异常, 拆开检查内部均无进水。

检 测 报 告

编号: J1802059R01C

报告日期: 2018/03/23

页码: 4 of 12

样品或测试照片:

1.三综合试验

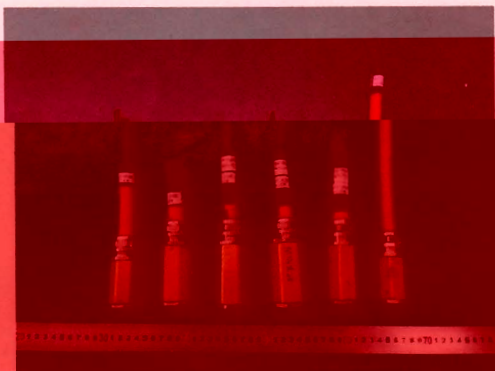


图 1 测试前

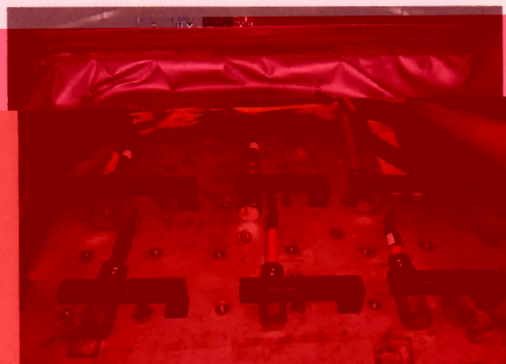


图 2 X 轴

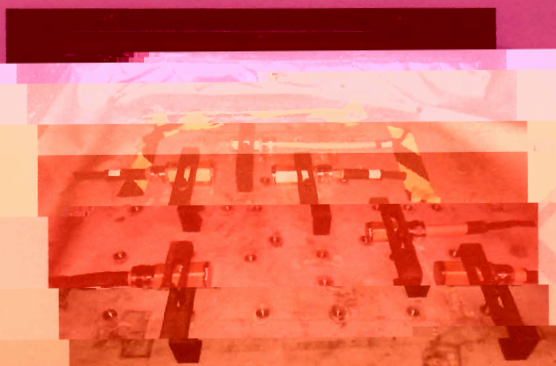


图 3 Y 轴

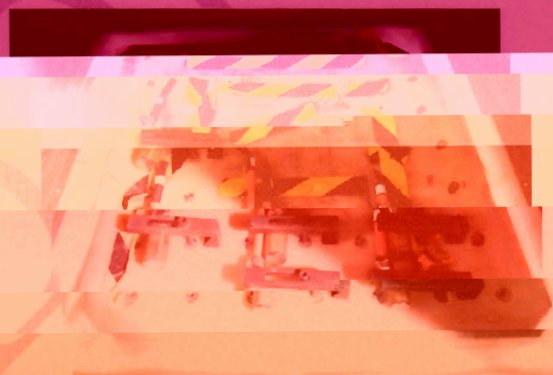


图 4 Z 轴

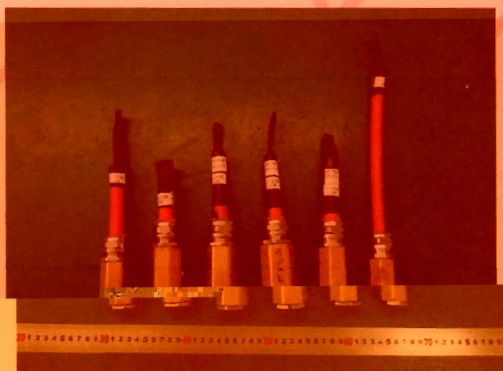


图 5 测试后

检 测 报 告

样品号: 1190805050400

报告日期: 2018/03/23

页码: 5 of 12

2. IPX8

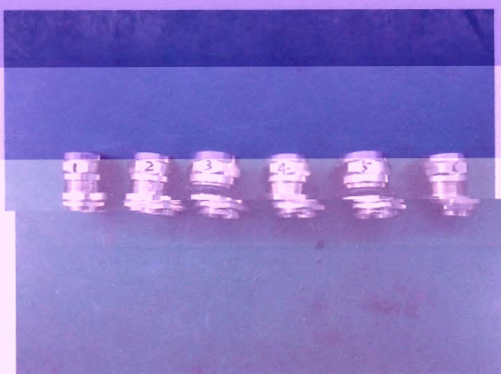


图 6 测试前

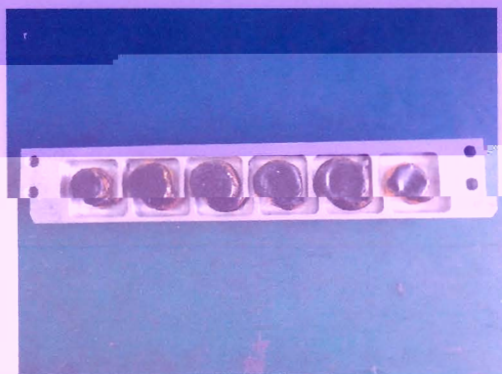


图 7 测试前 密封处理

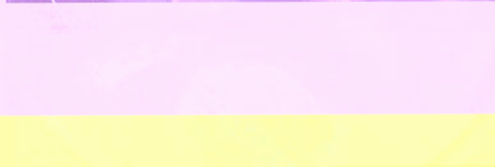


图 8 测试中

图 9 测试中



图 10 测试中

图 11 测试中



图 12 测试中

图 13 测试中



图 14 测试中

图 15 测试中

检测报告

编号: J1802059R01C

报告日期: 2018/03/23

页码: 6 of 12



图 12 测试后 2# 无进水




图 13 测试后 3# 无进水

检测报告

编号: I1802059R01C

报告日期: 2020/10/24

页码: 1 / 1

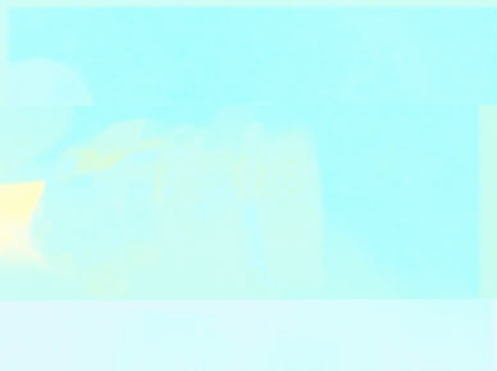

检 测 报 告

编号: 13802503R07C

报告日期: 2018/03/23

页码: 8 of 12



图 23 测试后 2# 无进水



图 24 测试后 3# 无进水



图 25 测试后 3# 无进水



图 26 测试后 4# 无进水



图 27 测试后 4# 无进水

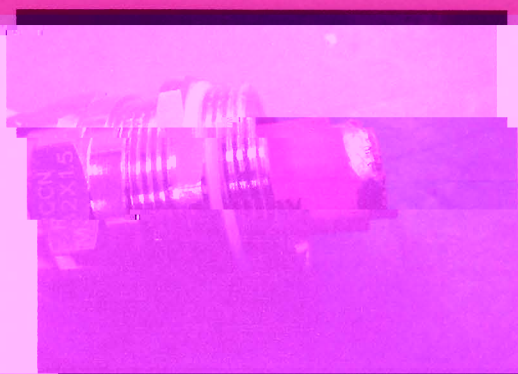




图 28 测试后 5# 无进水

检测 报 告

编号：J1802059R01C

报告日期：2018/03/23

页码：9 of 12

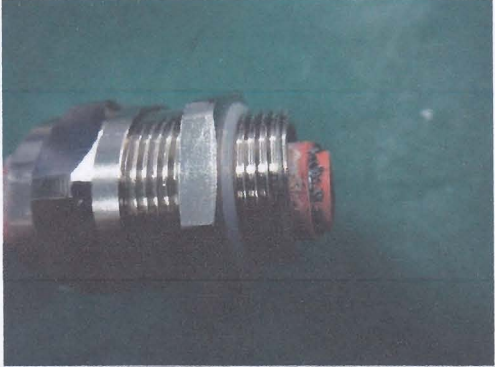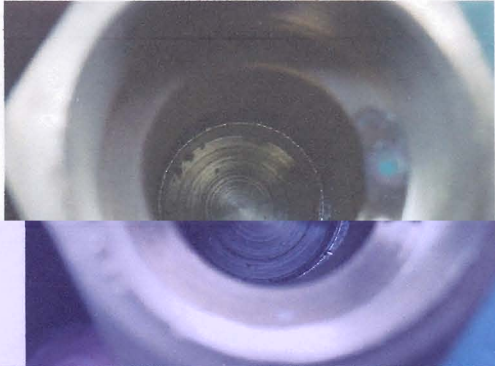	
图 29 测试后 5`# 无进水	图 30 测试后 6`# 无进水
	/
图 31 测试后 6`# 无进水	/

检测报告

副本

编号: J1802059R01C

报告日期: 2018/03/23

页码: 10 of 12

检测图谱:

1.三综合试验

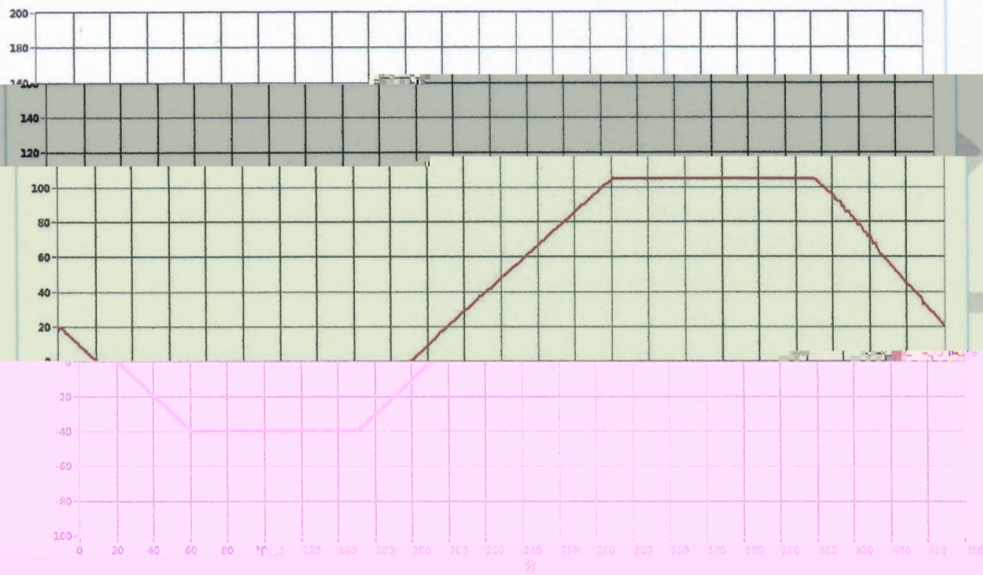


图 32 X 轴温度曲线

m/215-11c
27534.2

AP50

1000



检测报告

副本

编号: U8020509K00

报告日期: 2018/03/23

页码: 11 of 12


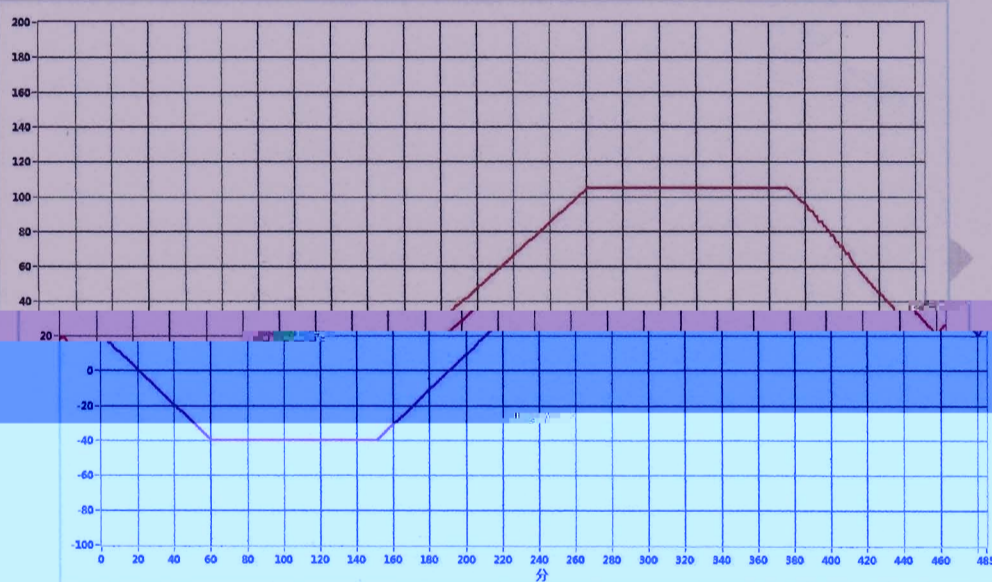


图 34 Y 轴温度曲线

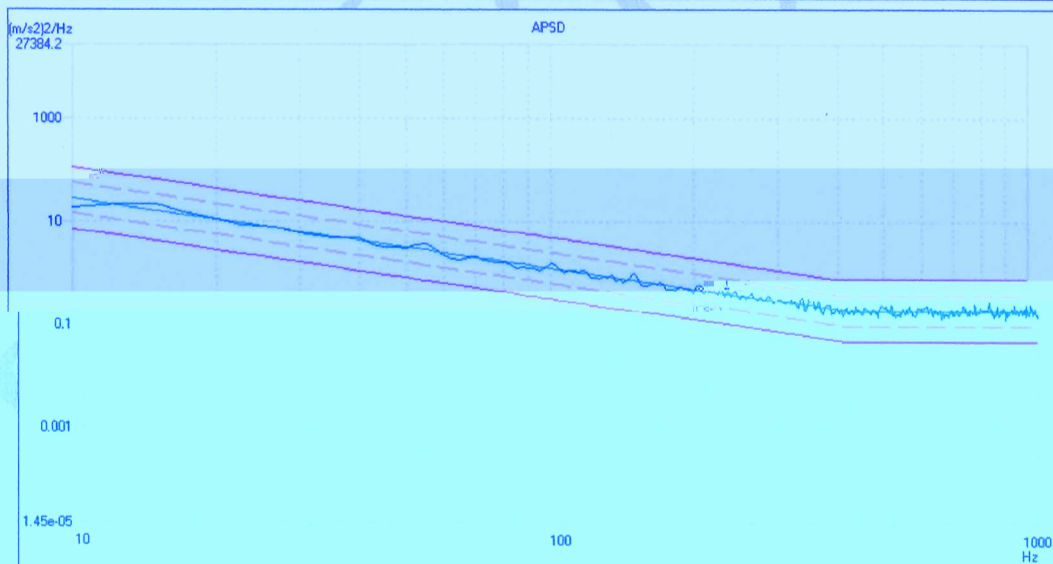

检测报告

副本

编号: J1802059R01C

报告日期: 2018/03/23

页码: 12 of 12

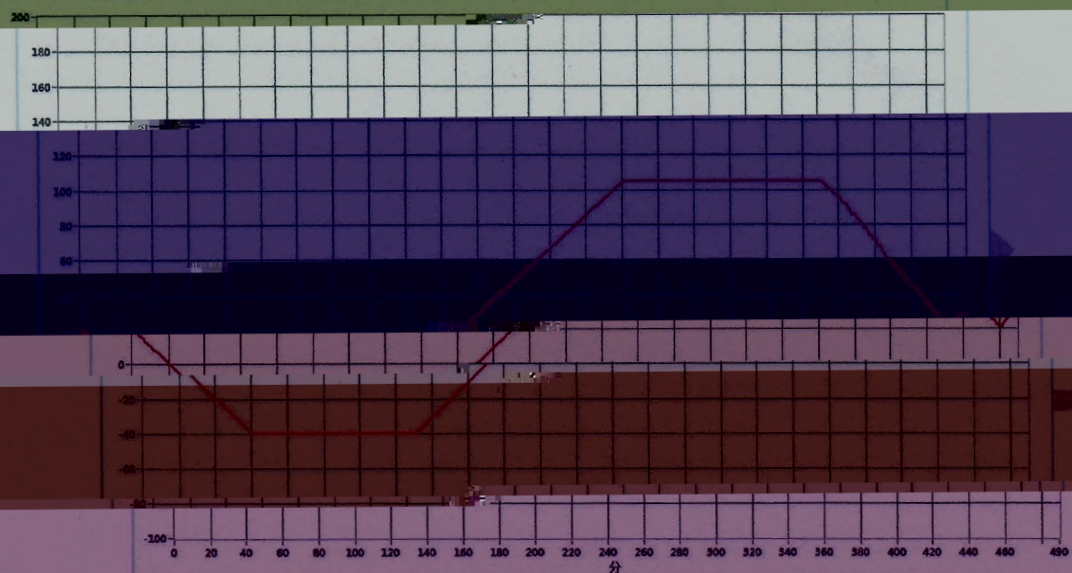


图 36 Z 轴温度曲线

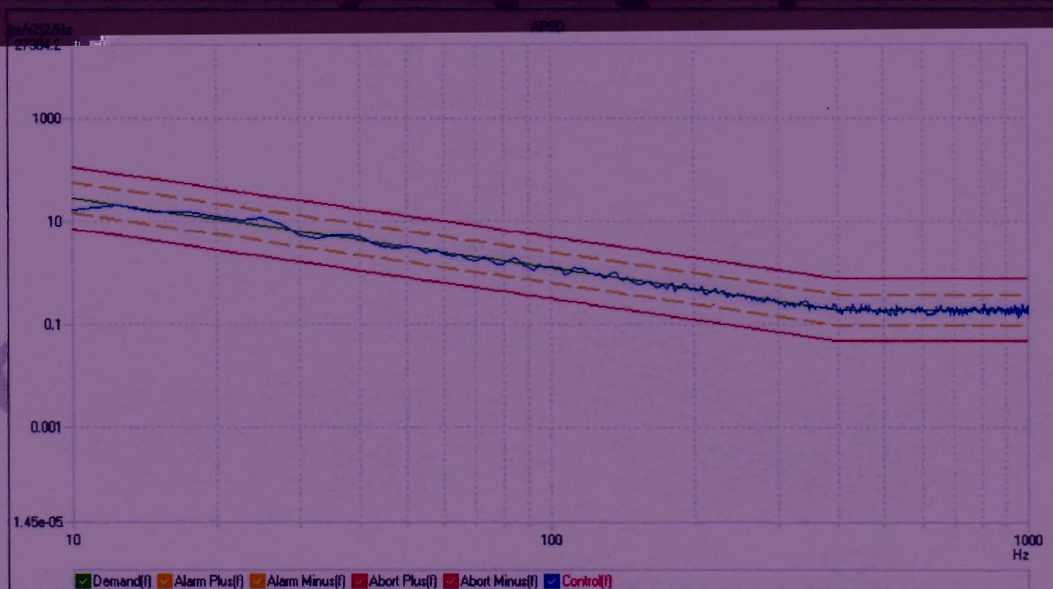


图 37 Z 轴振动曲线

报告结束